



TTSH REV 3 ERRORS

**DOUBLE FET HAS WRONG PINOUT! THIS IS FOR ALL 2N3954 AND 2N3958!
CROSS PINS 5 AND 6, SO IT LOOKS LIKE IT HAS TO GO TO THE BATHROOM.**

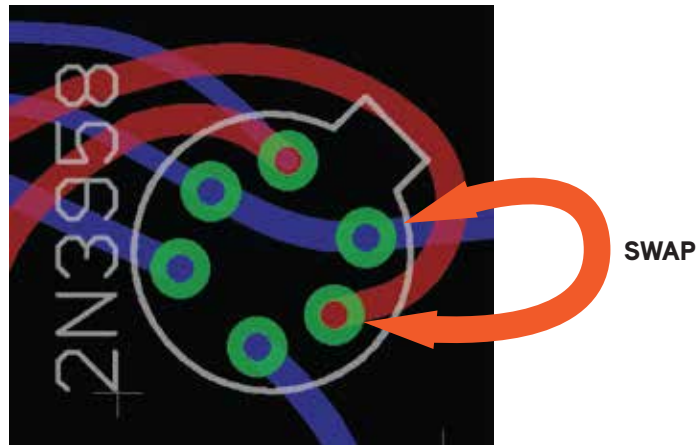

**MISSING TRACE – 4072 BOARD.
-14V IS MISSING FOR THE 1458 CHIP. JUMPER FROM NEARBY RESISTOR.**

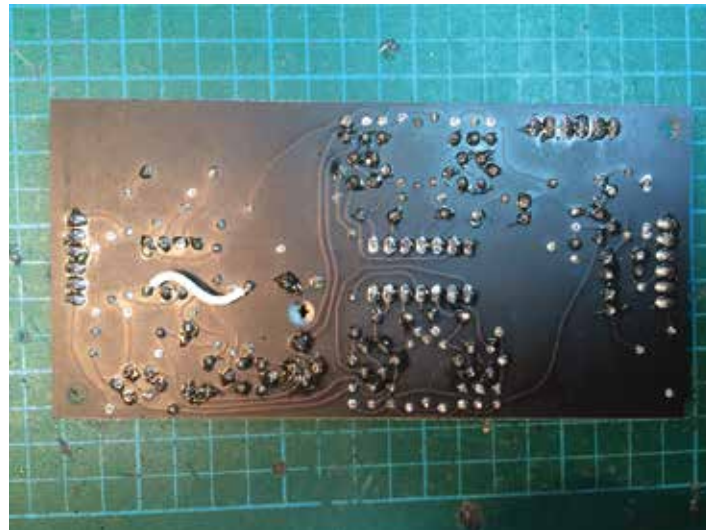


**MISSING TRACE – FILTER SECTION, MAIN BOARD.
V- IS MISSING IN HEADER FOR FILTER BOARD. JUMPER FROM POWER CONNECTOR**



TTSH REV 3 ERRORS

THE BC558 LEGEND IS WRONG – INSTALL IT BACKWARDS ON 4012 FILTER BOARD

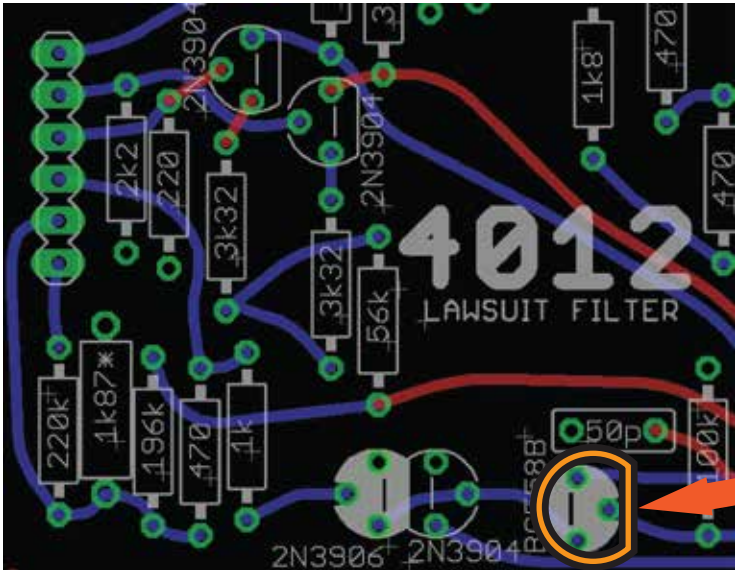

FLAT SIDE
FACING
THIS WAY